

# UNI-T®

## UT531 UT532 UT533 Users Manual

## Insulation Resistance Multimeters

P/N:110401103678X  
DATE:2018.06.26  
REV.4



### Table of Contents

| Title                                | Page |
|--------------------------------------|------|
| Introduction                         | 5    |
| Safety Information                   | 5    |
| Unpacking Inspection                 | 9    |
| The Meter Structure                  | 10   |
| Rotary Switch Positions              | 11   |
| Buttons                              | 13   |
| Understanding the Display            | 17   |
| Making Basic Measurements            | 20   |
| Measuring AC Voltage                 | 20   |
| Measuring DC Voltage                 | 23   |
| Measuring DC Millivolts              | 25   |
| Measuring Resistance and Capacitance | 27   |
| ● Measuring Resistance               | 27   |
| ● Measuring Capacitance              | 29   |
| Testing for Continuity               | 31   |
| Testing Diodes                       | 33   |
| Measuring AC or DC Current           | 35   |
| Measuring Frequency                  | 38   |
| Measuring Temperature                | 40   |
| Testing Insulation                   | 42   |

| Title                                 | Page |
|---------------------------------------|------|
| Cleaning                              | 45   |
| Replacing the Batteries               | 46   |
| Replacing the Fuse                    | 48   |
| Specifications                        | 49   |
| Electrical Specifications             | 50   |
| AC Voltage Measurement                | 50   |
| DC Voltage Measurement                | 51   |
| DC Millivolts Measurement             | 51   |
| AC Current Measurement                | 51   |
| DC Current Measurement                | 52   |
| Ohms Measurement                      | 52   |
| Capacitance                           | 52   |
| Diode Test                            | 53   |
| Continuity Test                       | 53   |
| Temperature Measurement               | 53   |
| Frequency Measurement                 | 54   |
| ● At mV $\overline{\text{---}}$ Range | 54   |
| ● At DCV/ACV Range                    | 55   |
| Insulation Specifications             | 55   |
| ● UT531                               | 55   |
| ● UT532                               | 56   |
| ● UT533                               | 57   |

### List of Tables

| Table | Title                    | Page |
|-------|--------------------------|------|
| 1.    | Symbols                  | 8    |
| 2.    | Unpacking Inspection     | 9    |
| 3.    | Rotary Switch Selections | 12   |
| 4.    | Buttons                  | 14   |
| 5.    | Display Indicators       | 18   |
| 6.    | General Specifications   | 49   |

### List of Figures

| Figure | Title                          | Page |
|--------|--------------------------------|------|
| 1.     | The Meter Structure            | 10   |
| 2.     | Rotary Switch                  | 11   |
| 3.     | Buttons                        | 13   |
| 4.     | Display Indicators             | 17   |
| 5.     | Measuring AC Voltage           | 20   |
| 6.     | Measuring DC Voltage           | 23   |
| 7.     | Measuring DC Millivolts        | 25   |
| 8.     | Measuring Resistance           | 27   |
| 9.     | Measuring Capacitance          | 29   |
| 10.    | Testing for Continuity         | 31   |
| 11.    | Testing Diodes                 | 33   |
| 12.    | Measuring AC or DC Current     | 35   |
| 13.    | Measuring Frequency            | 38   |
| 14.    | Measuring Temperature          | 40   |
| 15.    | Testing Insulation             | 42   |
| 16.    | Replacing the Fuse and Battery | 46   |

### Introduction

The UNI-T Models UT531, UT532 and UT533 are battery-powered, true RMS insulation multimeters (hereafter “the Meter”) with 6000 count display.

The Meter measures or tests the following:

- AC/DC voltage and current
- Resistance
- Voltage and current frequency
- Diode
- Continuity
- Capacitance
- Temperature (Model 532 and UT533 only)
- Insulation Testing

### Safety Information

These Meters meet CAT III 1000V and CAT IV 600V IEC61010 standards: in pollution degree 2 and double injection.

CAT III: Distribution level, fixed installation, with smaller transient overvoltages than CAT IV.

CAT IV: Primary supply level, overhead lines, cable systems etc.

Use the Meter only as specified in this users manual. Otherwise protection provided by the Meter may be impaired. See Table 1 for a list of symbols used on the Meter and in this manual.

A  **Warning** identifies hazardous conditions and actions that could cause bodily harm or death.

A  **Caution** identifies conditions and actions that could damage the Meter, the equipment under test, or cause permanent loss of data.

### **Warning**

To avoid possible electric shock or personal injury, follow these guidelines:

- Use the Meter only as specified in this manual or the protection provided by the Meter might be impaired.
- Do not use the Meter or test leads if they appear damaged, or if the Meter is not operating properly. If in doubt, have the Meter serviced.
- Always use the proper terminal, switch position, and range for measurements before connecting Meter to circuit under test.

- **Verify the Meter's operation by measuring a known voltage.**
- **Do not apply more than the rated voltage as marked on the Meter, between the terminals or between any terminal and earth ground.**
- **Use caution with voltages above 33V ac rms, 46.7V ac Peak, or 70V dc. These voltages pose a shock hazard.**
- **Replace the battery as soon as the low battery indicator (  ) appears.**
- **Disconnect circuit power and discharge all high-voltage capacitors before testing resistance, continuity, diodes, or capacitance.**
- **Do not use the Meter around explosive gas or vapor.**
- **When using the test leads, keep your fingers behind the finger guards.**
- **In order to comply with the safety standard, the Meter must be used along with the included test leads. Any damages of the test lead, must replace it with the same model number and specification.**
- **Remove test leads from the Meter before opening the Meter case or battery door. Never operate the Meter with the cover removed or the battery door open.**
- **Comply with local and national safety requirements when working in hazardous locations.**
- **Under the influence of Radio-Frequency Electromagnetic Field & Conducted Radio-Frequency Electromagnetic Field phenomenon. The captioned model have a magnificent error in function measurement. It will be back to normal when the interference is removed.**

- Use proper protective equipment, as required by local or national authorities when working in hazardous areas.
- Avoid working alone.
- User only the replacement fuse specified or the protection may be impaired.
- Check the test leads for continuity before use. Do not use if the readings are high or noisy.
- Do not use current terminals or current range to test voltage.

**Table 1. Symbols**

|                                                                                   |                                        |                                                                                   |                                                  |
|-----------------------------------------------------------------------------------|----------------------------------------|-----------------------------------------------------------------------------------|--------------------------------------------------|
|  | Double Insulated                       |  | Earth Ground                                     |
|  | AC (Alternating Current)               |  | DC (Direct Current)                              |
|  | Diode                                  |  | Battery (Low battery when shown on display)      |
|  | Continuity Buzzer                      |  | AC or DC (Alternating Current or Direct Current) |
|  | Conforms to Standard of European Union |                                                                                   |                                                  |

## **Unpacking Inspection**

Open the package case and take out the Meter. Check the following items carefully to see any missing or damaged part:

**Table 2. Unpacking Inspection**

|                                            |          |
|--------------------------------------------|----------|
| Users Manual                               | 1 piece  |
| Test Lead                                  | 1 pair   |
| Short Lead                                 | 1 pair   |
| Alligator Clip                             | 1 pair   |
| K type thermocouple (UT532 and UT533 only) | 1 piece  |
| Batteries AA (AM3/LR6)                     | 6 pieces |

In the event you find any missing or damage, please contact your dealer immediately.

### The Meter Structure

1. Front Housing
2. LCD Display
3. Functional Buttons
4. Rotary Switch
5. Input Terminals

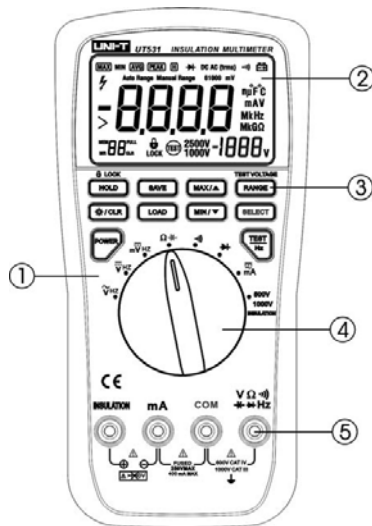


Figure 1. The Meter Structure

### Rotary Switch Positions

Turn the Meter on by pressing the **POWER** button. Use the **BLUE** button to select any rotary switch alternate functions (labeled with blue letters). Rotary switch selections are shown in Figure 2 and described in Table 3.

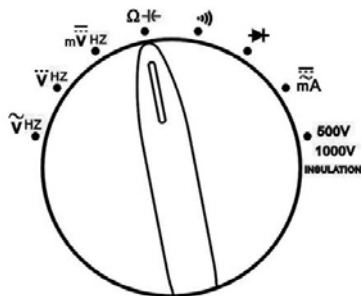


Figure 2. Rotary Switch

Table 3. Rotary Switch Selections

| Switch Position                     | Measurement Function                                                                                                                                                                                                                                            |
|-------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| $V \sim$                            | AC voltage from 60mV to 1000V.                                                                                                                                                                                                                                  |
| $V \text{---}$                      | DC voltage 1mV to 1000V.                                                                                                                                                                                                                                        |
| $mV \text{---}$                     | DC mV 0.01mV to 600mV                                                                                                                                                                                                                                           |
| (UT532 and UT533 only)              | Temperature from -40°C to +537°C (-40°F to +998°F). Celsius is the default temperature measurement unit.                                                                                                                                                        |
| $\Omega$ $\rightarrow$ $\text{---}$ | Ohms from 0.1 to 40M.<br>Capacitance from 0.01nF to 100μF.                                                                                                                                                                                                      |
| $\rightarrow$ $\text{---}$          | Continuity test. Beeper turns on at <30                                                                                                                                                                                                                         |
| $\rightarrow$ $\text{---}$          | Diode test. There is no ranging in this function.                                                                                                                                                                                                               |
| $mA \approx$                        | DC mA from 0.01mA to 600mA (600mA overload for 2 minutes maximum)<br>AC mA from 3mA to 600mA (600mA overload for 2 minutes maximum).                                                                                                                            |
| insulation                          | Press to perform insulation test<br>UT531: From 0.5M to 600M. Select 500V and 1000V testing voltage.<br>UT532: From 0.2M to 2G. Select 250V, 500V and 1000V testing voltage.<br>UT533: From 0.1M to 2G. Select 50V, 100V, 250V, 500V and 1000V testing voltage. |

### Buttons

Use the buttons to activate features that augment the function selected with the rotary switch. The buttons are shown in Figure 3 described in Table 4.

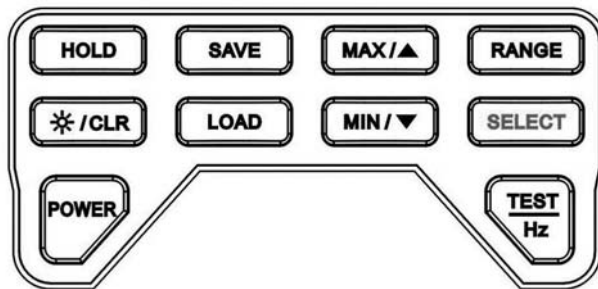


Figure 3. Buttons

Table 4. Buttons

| Button  | Description                                                                                                                                                                                                                                                                                                                                             |
|---------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| POWER   | Press <b>POWER</b> to turn on the Meter.<br>Press and hold <b>POWER</b> to turn off the Meter                                                                                                                                                                                                                                                           |
| HOLD    | In insulation Test mode, this schedules a test lock the next time you press <b>TEST</b> on the Meter. The test lock acts to hold down the button until you press <b>HOLD</b> or <b>TEST</b> again to release the lock.<br>In order measurement mode: Press to freeze the displayed value.<br>Press again to release the display.                        |
| * / CLR | Press and hold the button to clear the stored data.<br>Press the button to turn the backlight on and off.                                                                                                                                                                                                                                               |
| SAVE    | Press this button to store the single record.<br>Press and hold this button to store data continuously. Press <b>SAVE</b> again to exit continuous data storing mode.<br>The maximum number of data store is 99 sets. The Meter displays FULL when it reaches the maximum. Press <b>CLR</b> to clear the stored data in order to store next set of data |

Table 4. Buttons

| Button  | Description                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|---------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| LOAD    | <ul style="list-style-type: none"> <li>● Press this button once to recall the stored value. Press or to recall the previous or next stored value. Press <b>LOAD</b> again to exit data recall mode.</li> <li>● Press and hold this button to recall the stored data continuously. Press <b>LOAD</b> again to exit.</li> <li>● After entering the Load mode, it is not allowed to turn the rotary switch to enter to measuring mode. You can only enter the measuring mode after exiting the Load mode.</li> </ul> |
| MAX / ▲ | <p>In Measurement mode, except buzzer, diode and insulation test, press to start retaining maximum value.</p> <p>In Load, each press to go back to the previous stored reading</p>                                                                                                                                                                                                                                                                                                                                |
| MIN / ▼ | <p>In Measurement mode, except buzzer, diode and insulation test, press to start retaining minimum value.</p> <p>In Load, each press to recall the next stored reading.</p>                                                                                                                                                                                                                                                                                                                                       |
| RANGE   | <p>In Insulation Test mode, press to select different testing voltage.</p> <p>In other mode, except buzzer and diode, press to change Ranging</p>                                                                                                                                                                                                                                                                                                                                                                 |

Table 4. Buttons

| Button            | Description                                                                                                                                                             |
|-------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| RANGE             | mode from Auto to Manual Ranging mode. Press and hold to return to Auto Ranging mode.                                                                                   |
| SELECT            | Functions as a shift key. Press to access orange functions on the rotary switch.                                                                                        |
| <u>TEST</u><br>Hz | Initiates an insulation test when the rotary switch is on the INSULTION position. Causes the Meter to source (output) a high voltage and measure insulation resistance. |
|                   | InMeasurement mode, activate frequency measurement.                                                                                                                     |

### Understanding the Display

Display indicators are shown in Figure 4 and described in Table 5.

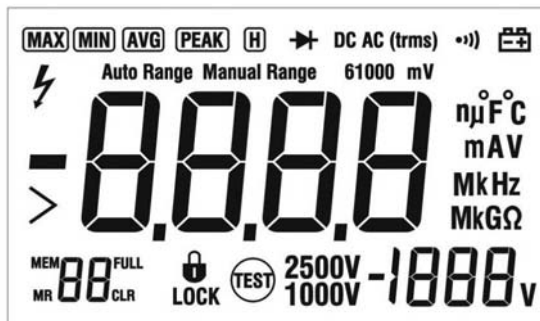


Figure 4. Display Indicators

Table 5. Display Indicators

| Indicator                                                                         | Description                                                                                                                                                                                                                                            |
|-----------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| MAX                                                                               | Indicates maximum reading has been selected.                                                                                                                                                                                                           |
| MIN                                                                               | Indicates minimum reading has been selected.                                                                                                                                                                                                           |
| H                                                                                 | Indicates display hold is active                                                                                                                                                                                                                       |
|  | Diode test function is selected                                                                                                                                                                                                                        |
| DC AC                                                                             | AC / DC Voltage or Current measurement                                                                                                                                                                                                                 |
| trms                                                                              | True RMS measurement                                                                                                                                                                                                                                   |
|  | Continuity test function is selected                                                                                                                                                                                                                   |
|  | Low battery. Indicates when it is time to replace the battery.<br><b>⚠ Warning</b><br><b>To avoid false readings, which could lead to possible electric shock or personal injury, replace the battery as soon as the low battery indicator appears</b> |
|  | High voltage warning                                                                                                                                                                                                                                   |
| Auto Range                                                                        | Auto ranging mode                                                                                                                                                                                                                                      |
| Manual Range                                                                      | Manual ranging mode                                                                                                                                                                                                                                    |

Table 5. Display Indicators

| Indicator                                                                                                                                                           | Description                                                                                                                                                                                        |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 61000mV                                                                                                                                                             | Display range in use                                                                                                                                                                               |
| —                                                                                                                                                                   | Negative symbol                                                                                                                                                                                    |
| >                                                                                                                                                                   | Greater than symbol                                                                                                                                                                                |
| 8888                                                                                                                                                                | Primary display                                                                                                                                                                                    |
| MEM                                                                                                                                                                 | Data store symbol                                                                                                                                                                                  |
| MR                                                                                                                                                                  | Data recall symbol                                                                                                                                                                                 |
| 99                                                                                                                                                                  | The number of stored data                                                                                                                                                                          |
| FULL                                                                                                                                                                | When the number of stored data reaches 99, the display will show FULL.<br>When the number of stored data is full, press <b>CLR</b> to clear up the stored data before storing another set of data  |
| CLR                                                                                                                                                                 | Clear up the stored data                                                                                                                                                                           |
|   | Indicates a test lock will be applied the next time you press <b>TEST</b> on the Meter. The test lock acts to hold down the button until you press <b>HOLD</b> or <b>TEST</b> again.               |
| 2500V<br>1000V                                                                                                                                                      | Source voltage rating for insulation test.<br>UT531: 500V and 1000V ranges available.<br>UT532: 250V, 500V and 1000V ranges available.<br>UT533: 50V, 100V, 250V, 500V and 1000V ranges available. |
| 1888.8                                                                                                                                                              | Secondary Display                                                                                                                                                                                  |
|                                                                                    | Measurement units                                                                                                                                                                                  |

### Making Basic Measurements

*Measuring AC Voltage* (see figure 5)

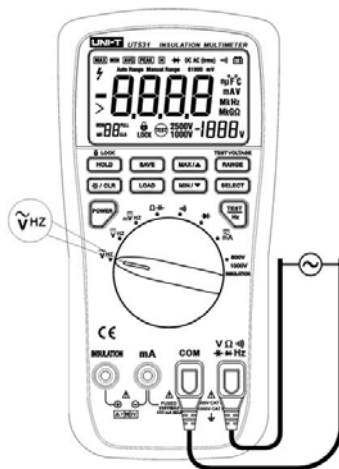


Figure 5. Measuring AC Voltage



### Warning

**To avoid harm to you or damages to the Meter from electric shock, please do not attempt to measure voltages higher than 1000V although readings may be obtained.**

The AC Voltage ranges are: 6.000V, 60.00V, 600.0V and 1000V. If over the range, it displays "OL". To measure AC voltage, connect the Meter as follows:

1. Insert the red test lead into the **VΩ  Hz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to **V~**.
3. Connect the test leads across with the object being measured.  
The measured value shows on the display.
4. The displayed value is True RMS.

**Note:**

- If the value of voltage to be measured is unknown, set the Meter to autoranging or use the maximum measurement position 1000V and reduce the range step by step until a satisfactory reading is obtained.
- In each range, the Meter has an input impedance of  $10\text{M}\Omega$ . This loading effect can cause measurement errors in high impedance circuits. If the circuit impedance is less than or equal to  $10\text{k}\Omega$ , the error is negligible (0.1% or less).
- When DC voltage measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

## UT531/UT532/UT533 : USERS MANUAL

### *Measuring DC Voltage* (see figure 6)

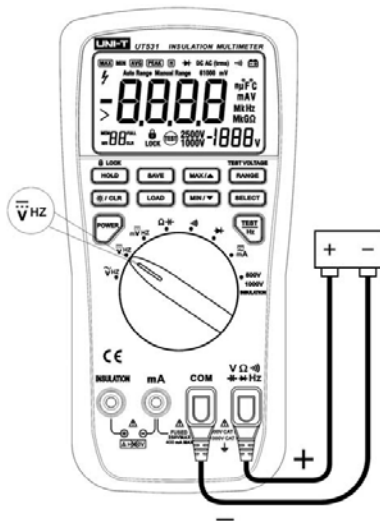


Figure 6.Measuring DC Voltage

### Warning

**To avoid harm to you or damages to the Meter from electric shock, please do not attempt to measure voltages higher than 1000V although readings may be obtained.**

The DC Voltage ranges are: 6.000V, 60.00V, 600.0V and 1000V. If over the range, it displays "OL". To measure DC voltage, connect the Meter as follows:

1. Insert the red test lead into the **VΩ**  **Hz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to **V** .
3. Connect the test leads across with the object being measured. The measured value shows on the display.

### Note:

- If the value of voltage to be measured is unknown, set the Meter to autoranging or use the maximum measurement position 1000V and reduce the range step by step until a satisfactory reading is obtained.
- In each range, the Meter has an input impedance of 10MΩ. This loading effect can cause measurement errors in high impedance circuits. If the circuit impedance is less than or equal to 10kΩ, the error is negligible (0.1% or less).
- When DC voltage measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

## UT531/UT532/UT533 : USERS MANUAL

### *Measuring DC Millivolts* (see figure 7)

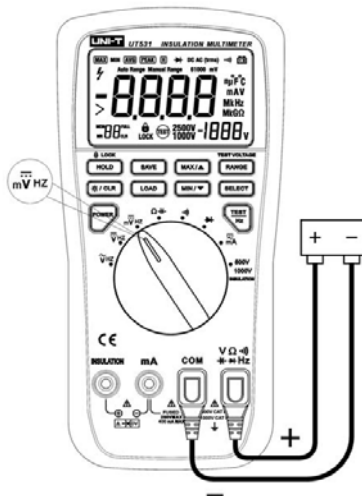


Figure 7.Measuring DC Millivolts



### Warning

**To avoid harm to you or damages to the Meter from electric shock, please do not attempt to measure voltages higher than 500V, otherwise you cannot obtain correct reading.**

The DC Millivolts ranges are: 60.000mV and 600.0mV. If over the range, it displays "OL". To measure DC Millivolts, connect the Meter as follows:

1. Insert the red test lead into the **VΩ  Hz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to **mV **.
3. Connect the test leads across with the object being measured.  
The measured value shows on the display.

### Note:

- The maximum input impedance is 4000MΩ.
- When DC Millivolts measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads

### ***Measuring Resistance and Capacitance***

- ***Measuring Resistance*** (see figure 8)

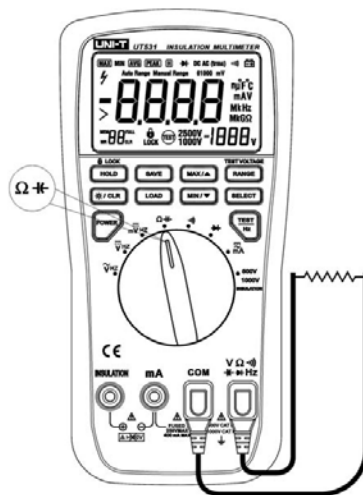


Figure 8.Measuring Resistance



### Warning

**To avoid electric shock, injury, or damage to the Meter, disconnect circuit power and discharge all high-voltage capacitors before testing resistance.**

The Resistance ranges are 600.0 $\Omega$ , 6.000k $\Omega$ , 60.00k $\Omega$ , 600.0k $\Omega$ , 6.000M $\Omega$  and 40.00M $\Omega$

To measure resistance, connect the Meter as follows:

1. Insert the red test lead into the **V $\Omega$ Hz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to  **$\Omega$** . Resistance measurement is default or press **SELECT** button to select  $\Omega$  measurement mode.
3. Connect the test leads across with the object being measured.  
The measured value shows on the display.

### Note:

- When Resistance measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

## UT531/UT532/UT533 : USERS MANUAL

- **Measuring Capacitance** (see figure 9)

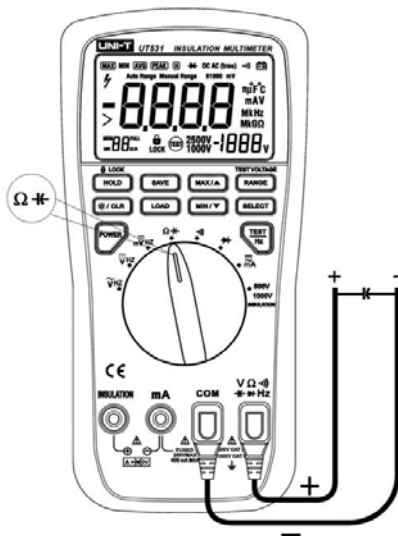


Figure 9. Measuring Capacitance

### Warning

**To avoid electric shock, injury, or damage to the Meter, disconnect circuit power and discharge all high-voltage capacitors before testing capacitance. Use the DC Voltage function to confirm that the capacitor is discharged.**

The Capacitance ranges are 10.00nF, 100.0nF, 1000nF, 10.00  $\mu$ F and 100.0  $\mu$ F

To measure capacitance, connect the Meter as follows:

1. Insert the red test lead or red short lead with alligator clip into the **V $\Omega$ H $\leftarrow$  $\rightarrow$ Hz** terminal and the black test lead or black short lead with alligator clip into the **COM** terminal. If the capacitor being tested has polarity, connect the positive into the **V $\Omega$ H $\leftarrow$  $\rightarrow$ Hz** terminal and the negative into the **COM** terminal
2. Set the rotary switch to  **$\Omega$ H $\leftarrow$** . Press **SELECT** button to select capacitance measurement mode
3. Connect the test leads across with the object being measured.  
The measured value shows on the display.

### Note:

- When Capacitance measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

## UT531/UT532/UT533 : USERS MANUAL

**Testing for Continuity** (see figure 10)

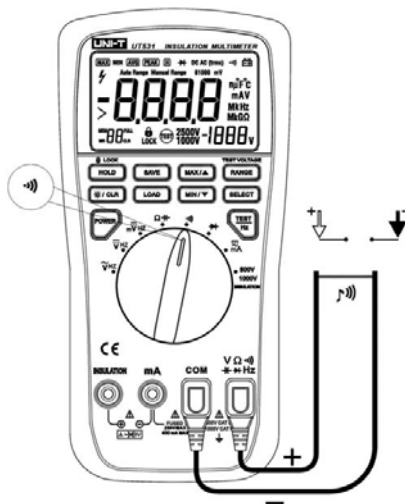


Figure 10. Testing for Continuity



### Warning

**To avoid electric shock, injury, or damage to the Meter, disconnect circuit power and discharge all high-voltage capacitors before testing continuity.**

To measure capacitance, connect the Meter as follows:

1. Insert the red test lead into the **V $\Omega$ Hz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to .
3. Continuous audible tone for test resistance below 30 $\Omega$

### Note:

- When Continuity measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

## UT531/UT532/UT533 : USERS MANUAL

### Testing Diodes (see figure 11)

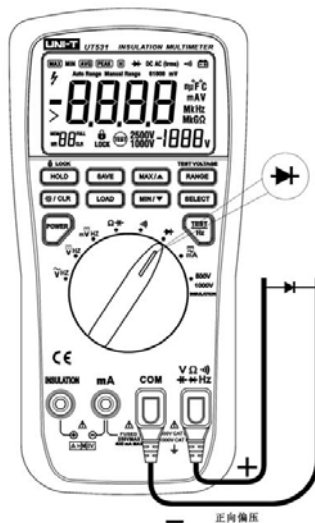


Figure 11. Testing Diodes



### Warning

**To avoid electric shock, injury, or damage to the Meter, disconnect circuit power and discharge all high-voltage capacitors before testing diodes.**

To measure diode, connect the Meter as follows:

1. Insert the red test lead into the **VΩHfHz** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to **→H→**.
3. For forward voltage drop readings on any semiconductor component, place the red test lead on the component's anode and place the black test lead on the component's cathode.

The measured value shows on the display.

### Note:

- In a circuit, a good diode should still produce a forward voltage drop reading of 0.5V to 0.8V; however, the reverse-voltage drop reading can vary depending on the resistance of other pathways between the probe tips.
- Connect the test leads to the proper terminal as said above to avoid error display. The LCD will display OL indicating diode being tested is open or polarity is reversed.
- The unit of diode is Volt (V), displaying the forward voltage drop readings.
- When Diode measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

### *Measuring AC or DC Current* (see figure 12)

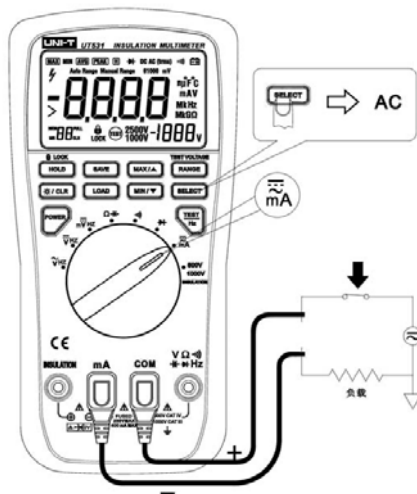


Figure 12.Measuring AC or DC Current



### Warning

To avoid personal injury or damage to the Meter:

- Never attempt to make an in-circuit current measurement when the open-circuit potential to earth is greater than 600V.
- Inspect Meter's fuses before testing. Broken fuses may damage to the Meter or hurt yourselves
- Use the proper terminals, switch position, and range for your measurement.
- Never place the probes in parallel with circuit or component when the leads are plugged into the current terminals.

The current ranges are 60.00mA and 600.0mA.


To measure current, connect the Meter as follows:

1. Insert the red test lead into the **mA** terminal and the black test lead into the **COM** terminal.
2. Set the rotary switch to mA . DC Current is default. Press **SELECT** to toggle to AC current measurement mode.
3. Connect the test leads across with the object being measured.  
The measured value shows on the display.
4. AC Current displays True RMS value.

### **Note:**

- If the value of current to be measured is unknown, set the Meter to autoranging or use the maximum measurement position 600.0mA and reduce the range step by step until a satisfactory reading is obtained.
- For safety sake, when measuring high current, each measurement time must be less than 10 seconds with an interval more than 15 minutes.
- When Current measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

### Measuring Frequency (see figure 13)

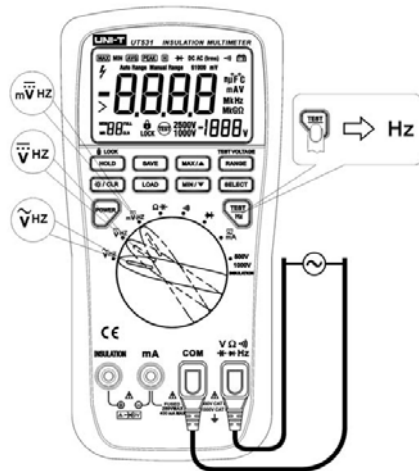

### Figure 13.Measuring Frequency

- Press **Hz** button to select frequency measurement mode at m **V $\sim$**  or **V $\sim$**  or **V $\rightleftharpoons$** . Press **Hz** to exit frequency measurement mode and return to the previous measurement mode.
- The maximum range of frequency is 1MHz.
- The signal attenuation is different from different measuring position and range. Therefore the required signal input amplitude and range may be different from different measuring position and range.
- It is recommended to use m**V $\rightleftharpoons$**  range which has higher input sensitivity.
- If the input amplitude is higher than 1Vrms, it is required to use **V $\rightleftharpoons$**  or **V $\sim$**  to carry out the measurement.
- When using current range to measure frequency, it is required to input signal more than 30% of full range. The reading obtained is only for reference.

### Note:

- When Frequency measurement has been completed, disconnect the connection between the testing leads and the circuit under test, and remove the testing leads away from the input terminals of the Meter.

### ***Measuring Temperature (UT532 and UT533 only)*** (see figure 14)

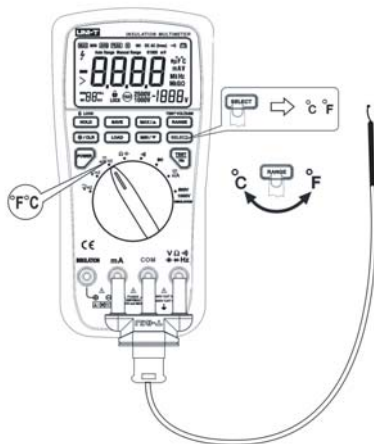


Figure 14.Measuring Temperature



### Warning

To avoid risk of shock do not connect thermocouple to electrically live circuits.



### Caution

To avoid possible damage to the Meter or other equipment, remember that while the Meter is rated for  $-40^{\circ}\text{C}$  to  $537^{\circ}\text{C}$  ( $-40^{\circ}\text{F}$  to  $998^{\circ}\text{F}$ ), the included K-type thermocouple is rated for  $260^{\circ}\text{C}$  ( $500^{\circ}\text{F}$ ). For temperature out of that range, use a higher rated thermocouple.

To measure temperature, connect the Meter as follows:

1. Insert the red thermocouple into the **VΩHz** terminal and the black thermocouple into the **COM** terminal.
2. Set the rotary switch to mV.
3. Press **SELECT** to choose temperature range.
4. Press **RANGE** to toggle between degrees Celsius ( $^{\circ}\text{C}$ ) or degrees Fahrenheit ( $^{\circ}\text{F}$ ).
5. Place the thermocouple to the object being measured.

The measured value shows on the display.

### *Testing Insulation* (see figure 15)



Figure 15. Testing Insulation

**Warning**

**Make sure the circuit to be tested is dead before taking measurement. Never measure the insulation resistance of live equipment or circuit. Never touch the circuit after measurement, as the capacitance to be saved on the circuit may cause electric shock.**

**Insulation tests should only performed on dead circuits. Check the fuse before testing.**

To measure insulation resistance, set up the Meter as shown in Figure 15 and follow the steps below:

1. Insert the red short lead with alligator clip in the **INSULATION** input terminal and the black short lead with alligator clip in the **mA** input terminal.
2. Turn the rotary switch to **INSULATION** position.
3. Press **RANGE** to select the voltage.
4. Connect the probes to the circuit to be measured. There are two methods to start the insulation test:

- Press **HOLD** button to disable LOCK mode. Press and hold **TEST** to start the insulation test until **TEST** button is released
  - Press **HOLD** button to enter LOCK mode. Press **TEST** once to start the insulation test until pressing **HOLD** or **TEST** again to release LOCK mode.
5. Push and hold **TEST** button to start the test, the secondary display shows the test voltage applied to the circuit under test. The high voltage symbol along with a primary display showing the resistance in  $M\Omega$  or  $G\Omega$ . The TEST icon appears on the lower portion of the display.
  6. When releasing the **TEST** button, LCD will not appear TEST icon. The resistance reading appears on the primary display until a new test is started or a different function or range is selected.

**Caution**

The following improper operating procedure may force the Meter to power off automatically. To avoid the danger of electric shock and damage to the Meter:

- Replace batteries as soon as battery indicator is on. Initiating high voltage when the battery indicator is on, which may force the Meter to power off.
- Must connect the probe to the circuit being measured before initiating high voltage.
- When under high voltage mode , never turn the rotary switch to other position.
- The testing time of small resistor or short circuit cannot exceed 20 seconds.
- At insulation testing mode with testing voltage initiated, auto power off feature will be disabled until un-initiating the testing voltage.

**Cleaning**

- Periodically wipe the case with a damp cloth and mild detergent. Do not use abrasives or solvents. Dirt or moisture in the terminals can affect readings.
- Turn the Meter off when it is not in use.
- Do not use or store the Meter in a place of humidity, high temperature, explosive, inflammable and strong magnetic field.
- The internal circuit of the Meter shall not be altered at will to avoid damage of the Meter and any accident.

### Replacing the Batteries

Replace the batteries as shown in Figure 16. Follow the steps below to replace the batteries.

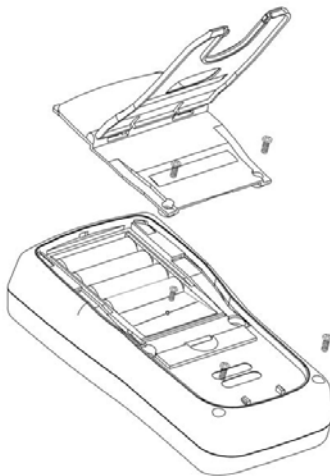


Figure 16. Replacing the Fuse and Battery

 **Warning**

**To avoid shock, injury, or damage to the Meter:**

- To avoid false readings, which could lead to possible electric shock or personal injury, replace the batteries as soon as the battery indicator  appears.
  - Turn the Meter off and remove the testing leads from the terminals.
- 
1. Remove the two screws from the battery door by using a standard screwdriver.
  2. Open the battery door.
  3. Remove and replace the batteries.  
6pcs of AA (AM3/LR6), standard capacity around 2450mAh.
  4. Rejoin the case bottom and battery compartment, and reinstall the screw.

### Replacing the Fuse

Replace the fuse as shown in Figure 16. Follow the steps below to replace the batteries.



#### **Warning**

**To avoid shock, injury, or damage to the Meter:**

- **Use ONLY fuses with the amperage and voltage specified.**
  - **Turn the Meter off and remove the testing leads from the terminals.**
1. Remove the two screws from the battery door, two screws from the case bottom, one screw at the back of the battery.
  2. Open the battery door and the case bottom
  3. Remove the fuse by gently prying one end loose, and take out the fuse from its bracket.
  4. Install ONLY replacement fuses with identical amperage and voltage specified:  
F1A 240V
  5. Rejoin the battery door and the case bottom, and reinstall the screws.
  6. Do not operate the Meter with the case opened.

Replacement of the fuse is seldom required. Burning of a fuse always results from improper operation.

### Specifications

Table 6. General Specifications

|                                                                                                     |                                                                                               |
|-----------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------|
| Maximum Voltage Applied to any Terminal                                                             | 1000V rms                                                                                     |
|  mA Input Terminal | 1A / 240V Fast Fuse , High breaking capacity Fuse                                             |
| Maximum Display                                                                                     | 6000, Updates 5 times per second                                                              |
| Operating Temperature                                                                               | 0°C ~40°C (32°F~104°F)                                                                        |
| Storage Temperature                                                                                 | -10°C ~50°C (14°F~122°F)                                                                      |
| Relative Humidity                                                                                   | ≤75% @ 0°C to below 31°C<br>≤50% @ 31°C to above 40°C                                         |
| Altitude                                                                                            | Operating: 2000 meter<br>Storage: 10000 meter                                                 |
| Batteries                                                                                           | Six AA 1.5V batteries AM3/LR6 (standard capacity around 2450mAh)                              |
| Low battery                                                                                         | LCD display  |
| Auto Power Off                                                                                      | The Meter will be automatically off when the Meter is not in use for more than 15 minutes     |
| Size                                                                                                | 97mm x 202mm x 46mm                                                                           |
| Weight                                                                                              | Around 505 g (including batteries)                                                            |

### Electrical Specifications

Accuracy:  $\pm(a \% \text{ of rdg} + b \text{ digits})$ , guarantee for 1 year.

Operating Temperature:  $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$

Relative Humidity:  $< 75\%$

### AC Voltage Measurement

| Range  | Resolution | Accuracy   |             | Input Protection                                                                          |
|--------|------------|------------|-------------|-------------------------------------------------------------------------------------------|
|        |            | 50Hz ~60Hz | 60Hz ~ 1kHz |                                                                                           |
| 6.000V | 1mV        | ± (1%+3)   | ± (2%+3)    | 1000V  |
| 60.00V | 10mV       |            | ± (2%+6)    |                                                                                           |
| 600.0V | 100mV      |            |             |                                                                                           |
| 1000V  | 1V         | ± (2%+3)   |             |                                                                                           |

Remarks:

- Input Impedance:  $\geq 10\text{M}\Omega$
- Displays effective value of sine wave
- Frequency Response: 50Hz~1kHz

### DC Voltage Measurement

| Range  | Resolution | Accuracy        | Input Protection |
|--------|------------|-----------------|------------------|
| 6.000V | 1mV        | $\pm (0.3\%+4)$ | 1000V $\approx$  |
| 60.00V | 10mV       |                 |                  |
| 600.0V | 100mV      |                 |                  |
| 1000V  | 1V         |                 |                  |

Remark:

- Input Impedance:  $\geq 10M\Omega$

### DC Millivolts Measurement

| Range   | Resolution  | Accuracy        | Input Protection |
|---------|-------------|-----------------|------------------|
| 60.00mV | 10 $\mu$ V  | $\pm (0.4\%+4)$ | 600Vp            |
| 600.0mV | 100 $\mu$ V |                 |                  |

Remark:

- Input Impedance:  $\geq 4000M\Omega$

### AC Current Measurement

| Range   | Resolution  | Accuracy        | Input Protection     |
|---------|-------------|-----------------|----------------------|
| 60.00mA | 10 $\mu$ A  | $\pm (1.5\%+2)$ | Fuse, Fast, 1A, 240V |
| 600.0mA | 100 $\mu$ A |                 |                      |

Remark:

- Displays True RMS value.
- Frequency Response 50Hz ~ 1kHz

### ***DC Current Measurement***

| Range   | Resolution  | Accuracy        | Input Protection     |
|---------|-------------|-----------------|----------------------|
| 60.00mA | 10 $\mu$ A  | $\pm (1.0\%+2)$ | Fuse, Fast, 1A, 240V |
| 600.0mA | 100 $\mu$ A |                 |                      |

### ***Ohms Measurement***

| Range           | Resolution   | Accuracy        | Input Protection |
|-----------------|--------------|-----------------|------------------|
| 600.0 $\Omega$  | 0.1 $\Omega$ | $\pm (0.9\%+2)$ | 600Vp            |
| 6.000k $\Omega$ | 1 $\Omega$   |                 |                  |
| 60.00k $\Omega$ | 10 $\Omega$  |                 |                  |
| 600.0k $\Omega$ | 100 $\Omega$ |                 |                  |
| 6.000M $\Omega$ | 1k $\Omega$  |                 |                  |
| 40.00M $\Omega$ | 10k $\Omega$ | $\pm (1.5\%+3)$ |                  |

### Capacitance Measurement

| Range         | Resolution | Accuracy     | Input Protection |
|---------------|------------|--------------|------------------|
| 10.00nF       | 10pF       | $\pm(3\%+5)$ | 600Vp            |
| 100.0nF       | 100pF      |              |                  |
| 1000nF        | 1nF        |              |                  |
| 10.00 $\mu$ F | 10 nF      |              |                  |
| 100.0 $\mu$ F | 100nF      |              |                  |

### Diode Test

- Resolution: 1mV
- Input Protection: 500Vp
- Open circuit voltage: around 3V
- Display approximate forward voltage drop nearest value.

### Continuity Test

- Continuity Indication: Continuous audible tone for test resistance below 30 $\Omega$ .
- Open Circuit Voltage: around 3V
- Input Protection: 500Vp
- Resolution: 0.1 $\Omega$

### Temperature Measurement (UT532 and UT533 only)

| Range       | Resolution | Accuracy  | Input Protection |
|-------------|------------|-----------|------------------|
| -40°C~537°C | 1°C        | ± (1%+10) | 600Vp            |
| -40°F~998°F | 2°F        | ± (1%+18) |                  |

### Frequency Measurement

#### ● At mV<sub>AC</sub> Range

| Range    | Resolution | Accuracy   | Input Protection |
|----------|------------|------------|------------------|
| 60.00Hz  | 0.01Hz     | ± (0.1%+3) | 600Vp            |
| 600.0Hz  | 0.1Hz      |            |                  |
| 6.000kHz | 1Hz        |            |                  |
| 60.00kHz | 10Hz       |            |                  |
| 600.0kHz | 100Hz      |            |                  |
| 1.000MHz | 1kHz       |            |                  |

Remark:

- Input Sensitivity:
  - ≤ When 100kHz: ≤ 100mV rms  
≥ 30mV rms
  - > When 100kHz: ≥ 100mV rms  
≤ 30V rms

### ● *At DCV/ACV Range*

| Range       | Accuracy        | Input Protection |
|-------------|-----------------|------------------|
| 10Hz~100kHz | $\pm (0.1\%+3)$ | 600Vp            |

Remark:

- Input amplitude:  $\geq 600\text{mV rms}$

### *Insulation Specifications*

#### ● *UT531*

| Testing Voltages     | Measurement Range              | Resolution    | Accuracy      |
|----------------------|--------------------------------|---------------|---------------|
| 500V<br>(0% to 20%)  | 0.5M $\Omega$ ~99.9M $\Omega$  | 0.1M $\Omega$ | $\pm (3\%+5)$ |
|                      | 100M $\Omega$ ~ 500M $\Omega$  | 1M $\Omega$   |               |
| 1000V<br>(0% to 20%) | 4.0M $\Omega$ ~ 99.9M $\Omega$ | 0.1M $\Omega$ |               |
|                      | 100M $\Omega$ ~ 600M $\Omega$  | 1M $\Omega$   |               |

Remark:

- Short-Circuit Test Current less than 2.0mA

### ● **UT532**

| Testing Voltages     | Measurement Range               | Resolution    | Accuracy      |
|----------------------|---------------------------------|---------------|---------------|
| 250V<br>(0% to 10%)  | 0.2M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ | $\pm (3\%+5)$ |
|                      | 100M $\Omega$ ~ 250M $\Omega$   | 1M $\Omega$   |               |
| 500V<br>(0% to 20%)  | 0.5M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ |               |
|                      | 100M $\Omega$ ~ 500M $\Omega$   | 1M $\Omega$   |               |
| 1000V<br>(0% to 20%) | 4.0M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ | $\pm (5\%+5)$ |
|                      | 100M $\Omega$ ~ 999M $\Omega$   | 1M $\Omega$   |               |
|                      | 1.00M $\Omega$ ~ 2.00G $\Omega$ | 10M $\Omega$  |               |

Remark:

- Short-Circuit Test Current less than 2.0mA

### ● **UT533**

| Testing Voltages     | Measurement Range               | Resolution    | Accuracy      |
|----------------------|---------------------------------|---------------|---------------|
| 50V<br>(0% to 10%)   | 0.1M $\Omega$ ~ 50.0M $\Omega$  | 0.1M $\Omega$ | $\pm (3\%+5)$ |
| 100V<br>(0% to 10%)  | 0.1~100.0M $\Omega$             | 0.1M $\Omega$ |               |
| 250V<br>(0% to 10%)  | 0.2M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ |               |
|                      | 100M $\Omega$ ~ 250M $\Omega$   | 1M $\Omega$   |               |
| 500V<br>(0% to 20%)  | 0.5M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ |               |
|                      | 100M $\Omega$ ~ 500M $\Omega$   | 1M $\Omega$   |               |
| 1000V<br>(0% to 20%) | 4.0M $\Omega$ ~ 99.9M $\Omega$  | 0.1M $\Omega$ | $\pm (5\%+5)$ |
|                      | 100M $\Omega$ ~ 999M $\Omega$   | 1M $\Omega$   |               |
|                      | 1.00G $\Omega$ ~ 2.00G $\Omega$ | 10M $\Omega$  |               |

Remark:

- Short-Circuit Test Current less than 2.0mA

\* END \*\*



## UT531/UT532/UT533 : USERS MANUAL

**UNI-T®**

**UNI-TREND TECHNOLOGY (CHINA) CO., LTD.**

No6, Gong Ye Bei 1st Road,  
Songshan Lake National High-Tech Industrial  
Development Zone, Dongguan City,  
Guangdong Province, China  
Tel: (86-769) 8572 3888  
<http://www.uni-trend.com>